

STRENGTH TEST PRESSURE REPORT

1ST. MAIN OR LINE NO. 191	DIVISION East Bay	ESTIMATE OR GM NO. GM 177336	DATE 7-28-72
------------------------------	----------------------	---------------------------------	-----------------

DESCRIPTION OF JOB
Antioch Town Station, "D" Street and West Tregallas Road, Antioch

DISTRICT
Diablo

DESIGN PRESSURE 600 PSI	CONSTRUCTION TYPE Design Factor 50%	LOCATION CLASS 3
----------------------------	--	---------------------


USING OR BRIDGING - STATE REASON FOR USE IF UNDER 30" OVER IN CLASS 3 OR 4 LOCATIONS - SEE RULE 401.2 & 3	IF REQUIRED BY GO112 RULE 401.2 & 3 HAS PIPELINE BEEN PROTECTED FROM EXTERNAL CORROSION? <input checked="" type="checkbox"/> YES <input type="checkbox"/> NOT REQ'D <input type="checkbox"/> NO (IF "NO" EXPLAIN)	IF REQUIRED BY GO112 RULE 401.2 & 3 HAS PIPELIN BEEN PROTECTED FROM HAZARDS? <input checked="" type="checkbox"/> YES <input type="checkbox"/> NOT REQ'D <input type="checkbox"/> NO (IF "NO" EXPLAIN)

TEST PRESSURE		
MAX. PSIG (LOW ELEVATION) 1080	MIN. PSIG (HIGH ELEVATION) 900	PERIOD OF TEST (MIN. 1 HOUR) 8 Hours

PIPE SIZE (O. D.)	WALL THICKNESS	PIPE SPECIFICATION (VERIFY IN FIELD)	
		API., GR., ERW, DSAW, SEAMLESS	FOOTAGE TESTED
30"	.347	API 5LX GR X-52	6' - 0"
16"	.500	API 5LX GR X-42	131' - 11"
6"	.280	API 5LX GR B	35' - 0"

TEST DATA	
DATE, TIME REACHED TEST PRESSURE 7-28-72 0806 Hours	FLUID USED Water
DATE, TIME TEST ENDED 7-28-72 1620 Hours	ACTUAL TEST PRESSURE 1050
REFERENCE DRAWING NO. 485691	

SCHEMATIC SKETCH SHOW LOCATION OF FACILITY TESTED, MIN. & MAX. ELEVATION IN FEET, AND INCORPORATED AREAS. NONE - SAY "NONE". USE SPACE BELOW.

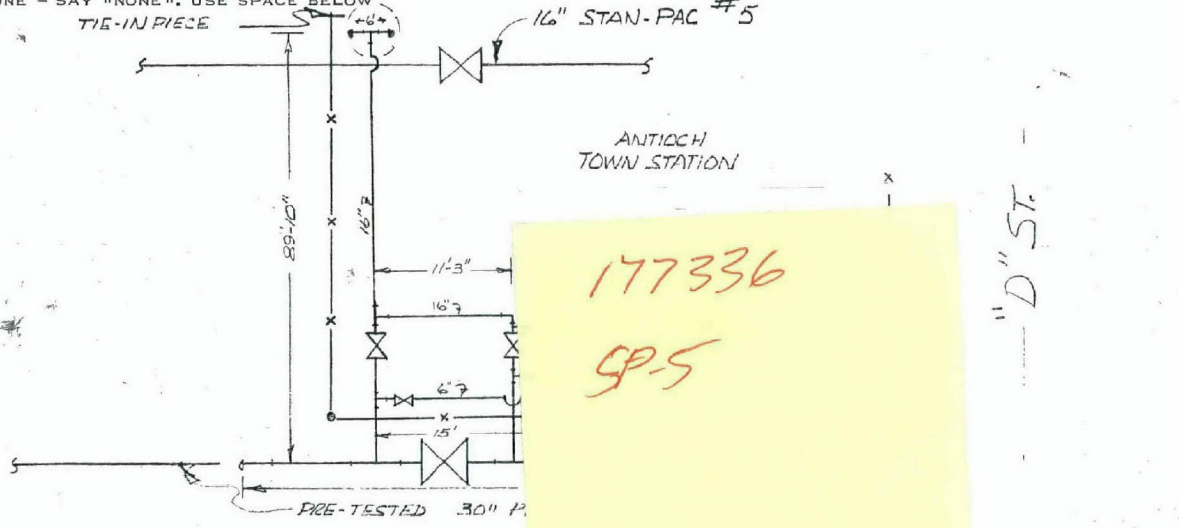

DISTRIBUTION
 T. GAS SUPT. - JOB FILE
 T. GAS SUPT.
 GAS-ASSIGNED JOBS
 3 SYSTEM DESIGN (2)
 INT ACCTS. (WITH
 DREMAN'S COPY OF JOB)
 REPORT FAILURES
 PER TEST TO GAS
 ITEM DESIGN